

Inspector: Flightlog: 10213

Date: 23.10.2024

Landings: 13569

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
08	Aircraft Weighing	Current calculation 22-Mar-2024		02.06.2020	96	44	02.06.2028
				9708		96	
				12623		0	
12	500 hr Special Inspection Lubrication Items	ref. Lubrication Chart		28.07.2021		0	
				9901	500	187	10400
				12973		0	
21	Cabin Heater	Overhaul - when Heater does not pass the pressure decay test !!	Janitrol FR 90D38-1EL	20.11.2007		0	
				8043		0	
			# A07100070			0	
21	Cabin Heater - Pressure Test i.a.w. AD 2004-21-05	New Heater installed at 2110 Hrs Hobbs. - - Px - Tested at 2471,3Hr Hobbs	FR 90D38-1EL	22.03.2024	24	17	31.03.2026
				10139	100	26	10239
			# A07100070	13431		0	
21	Combustion Heater	Overhaul (Heather Hobbs 3610 H)	FR 90D38-1EL	20.11.2007		0	
				8043		-283	
			# A07100070			0	
24	Alternator LH 500 H insp (Ref SIB NE-18-16)	Brush Inspection - Airlink recomendation		27.06.2024		0	
				10172	500	459	10672
				13497		0	
24	Alternator RH 500 H Insp (Ref SIB NE-18-16)	Brush Inspection - Airlink recomendation		22.03.2024		0	
				10139	500	426	10639
				13431		0	
24	Alternator LH	Overhaul/Replace due at 11.853H	Presotlite ALX-9525BR	27.06.2024		0	
				10172	1800	1640	11853
			# H-Q081864	13497		0	
24	Alternator RH	Overhaul/Replace (swapped from LH 22.03.2024)	Presotlite ALX-9525BR	02.06.2020		0	
				9708	1800	1295	11508
			# H-T101074	12623		0	

Inspector: Flightlog: 10213

Date: 23.10.2024

Landings: 13569

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
25	ELT Battery	Replace	Kannad 406AF	10.04.2020	72	18	10.04.2026
			Battery P/N S1820516-99			0	
			# P1273-0045			0	
25	First Aid Kit	Inspection refer CAT.IDE.A.220	Type 1	22.03.2024	12	5	31.03.2025
				10139		0	
				13431		0	
25	Safety Belts Crew and Pax	O/C -LTA 91 A (04.2017)		03.03.1999		14	
						0	
						0	
26	Fire Extinguisher Cabin - Overhaul	Overhaul	H AL 1 10 Air	13.02.2017	120	28	13.02.2027
			74-00	9160		0	
			# 17225			0	
27	Wing Flap - 200 hrs Insp.	Inspection for evidence of dissimilar metal corrosion		22.03.2024		0	
				10139	200	126	10339
				13431		0	
28	Fluid Hoses Wing and Fuselage - Fuel	Replacement		01.01.2020	240	183	01.01.2040
						0	
						0	
28	Fluid Hoses Wing and Fuselage - Fuel	Initial 10y, then 5y - Pressure Check and Visual Inspection		01.01.2020	120	63	01.01.2030
						0	
						0	
28	Fuel Tank Vent Lines	Replacement	S51-8-480	22.03.2024	84	77	31.03.2031
			MIL H 6000 - 1/2	10139	1000	926	11139
				13431		0	
29	Fluid Hoses Wing and Fuselage - Hydraulic	Initial 10y, then 5y - Pressure Check and Visual Inspection		22.03.2024	120	113	31.03.2034
				10139		0	
				13431		0	

Inspector: Flightlog: 10213

Date: 23.10.2024

Landings: 13569

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
29	Fluid Hoses Wing and Fuselage - Hydraulic	Replacement		22.03.2024	240	233	31.03.2044
				10139		0	
				13431		0	
29	Hydraulik Motor Brushes	Inspection	HYC 5005	28.07.2021		0	
			ESQ -12S (Brush)	9901	500	187	10400
			# 4473/AH-11561	12973		0	
31	Airspeed Indicator Nr. 1	Test i.a.w LTH40a	Un. Instr. 8125	22.03.2024	24	17	31.03.2026
				10139		0	
			81437	13431		0	
31	Airspeed Indicator Nr. 2	Test i.a.w. LTH40a	Un. Instr. 8125	22.03.2024	24	17	31.03.2026
				10139		0	
			98898	13431		0	
32	NLG Trunnion inspection	Inspect for cracks each 1000 hr i.a.w. SM Section VII	95723-005	01.09.2022		0	
				9994	1000	787	11000
				13126		0	
32	NLG Upper Drag Link Bolt	CHAPTER 4 ITEM - Replacement per AD 2005-13-16 - Airworthiness Limitation (NO TOLERANCE)	AN 7 -35	20.07.2021		0	
				9892	500	179	10392
						0	
34	Altimeter Nr. 1 (Encoding)	Test i.a.w. LTH 40a	Aerom. 8140 B -20	22.03.2024	24	17	31.03.2026
				10139		0	
			# 9950	13431		0	
34	Altimeter Nr. 2	Test i.a.w. LTH 40a	Unit. Instr. 5934PM-3	22.03.2024	24	17	31.03.2026
				10139		0	
			# 7K 728	13431		0	
34	Avionic IFCA Check (with LTH40A)	GNS430, GNS430W upgrade, RDR2000, KMD850MFD, GMA340, KI229 RMI		22.03.2024	24	17	31.03.2026
				10139		0	
				13431		0	

Inspector: Flightlog: 10213

Date: 23.10.2024

Landings: 13569

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
34	Emergency Compass	Deviation Check i.a.w LTH 40a		22.03.2024	24	17	31.03.2026
				10139		0	
				13431		0	
34	GTX330 XPonder check	STC EASA.A.C.04066		22.03.2024	12	5	31.03.2025
				10139		0	
				13431		0	
34	Pitot Static System	Leak Test i.a.w. LTH 40a		22.03.2024	24	17	31.03.2026
				10139		0	
				13431		0	
35	Oxygen Bottles/Regulators 1 & 2	Hydrostatic Test	Scott 32000-06	22.03.2024	60	51	31.01.2029
			3850 & 3729	10139		0	
			# 10801U # 21680V	13431		0	
36	Gyro Air Inline Filter LH	Replacement	2J4-6	22.03.2024	12	5	31.03.2025
			AA2J4-6	10139	500	426	10639
				13431		0	
36	Gyro Air Inline Filter RH	Replacement	2J4-6	22.03.2024	12	5	31.03.2025
			AA2J4-6	10139	500	426	10639
				13431		0	
36	Pneumatic check valve / manifold assy	Replace	1H24-11	01.02.2022	120	86	31.12.2031
				9968		0	
				21041-1	13076		0
37	Drive Coupling Suction Pump LH	Replacement refer Tempest SL 001		01.09.2022	72	47	30.09.2028
				9994		0	
				13126		0	
37	Drive Coupling Suction Pump RH	Replacement refer Tempest SL 001		01.09.2022	72	47	30.09.2028
				9994		0	
				13126		0	

Inspector: Flightlog: 10213

Date: 23.10.2024

Landings: 13569

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
37	Pneumatic Pump LH	Replacement	AA441CC-7	01.09.2022		0	
				9994	600	387	10600
			# 043S05	13126		0	
37	Pneumatic Pump RH	Repalcement - ref. Tempest SL-003-1	RAP442CW-6	01.09.2022		0	
				9994	600	387	10600
			# 10323	13126		0	
37	Vacuum Inlet Filter LH	Replacement	D9-14-3	22.03.2024	12	5	31.03.2025
			AAD9-14-3	10139	100	26	10239
				13431		0	
37	Vacuum Inlet Filter RH	Replacement	D9-14-3	22.03.2024	12	5	31.03.2025
			AAD9-14-3	10139	100	26	10239
				13431		0	
55	500H Clean & Lub Stab Trim Drum Screw	AMM 761-590 Sect. III - Special Inspection		01.09.2022		0	
				9994	500	287	10500
				13126		0	
61	AMM Special Inspection	in conjunction with PROP OVHL			72	7	23.05.2025
					2000	1363	11576
						0	
61	Propeller Governor LH	Overhaul refer SB 33580 latest Revision	Woodward C210659K-L	02.06.2020		1	
				9708	1800	1295	11508
			# 1496936-L/N-P	12623		0	
61	Propeller Governor RH	Overhaul refer SB 33580 latest Revision	Woodward 210658B-C	02.06.2020		1	
				9708	1800	1295	11508
			# 2128203B-E-H	12623		0	
61	Propeller LH OVHL	Overhaul refer McC SB 137 latest Revision	3AF34C 502/G80HA-4	23.05.2019	72	7	23.05.2025
				9576	2000	1363	11576
			# 991663			0	

Inspector: Flightlog: 10213

Date: 23.10.2024

Landings: 13569

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
61	Propeller removal LH	Remove sludge from crankshaft		22.03.2024		0	
				10139	500	426	10639
				13431		0	
61	Propeller removal RH	Remove sludge from crankshaft		22.03.2024		0	
				10139	500	426	10639
				13431		0	
61	Propeller RH OVHL	Overhaul refer McC SB 137 latest Revision	3AF34C 503/GL80HA-4	23.05.2019	72	7	23.05.2025
				9576	2000	1363	11576
			# 001164			0	
72	AMM Special Inspection	in conjunction with ENG OVHL			144	92	02.06.2032
					1800	1295	11508
						0	
72	Engine LH OVHL D.I.	Overhaul refer TCM SIL 98-9E	TCM TSIO 360-EB1B	02.06.2020	144	92	02.06.2032
				9708	1800	1295	11508
			# 833932-R	12623		0	
72	Engine RH OVHL D.I.	Overhaul refer TCM SIL 98-9E	TCM LTSIO 360-EB1B	02.06.2020	144	92	02.06.2032
				9708	1800	1295	11508
			# 808046-R	12623		0	
72	Induction Air Filter LH	Replacement	638 873	17.11.2020		0	
			460-632	9808	500	87	10300
				12781		0	
72	Induction Air Filter RH	Replacement	638 873	22.03.2024		0	
			640-632	10139	500	426	10639
				13431		0	
72	MP Relief Valve LH	Overhaul	Rajay 481028-9001	13.04.2007			
			641 404-1	7795			
			# JK000488	9031			

Inspector: Flightlog: 10213

Date: 23.10.2024

Landings: 13569

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
72	MP Relief Valve RH	Overhaul	Rajay 481028-9001	13.04.2007			
			641 404-1	7795			
			# JK000486	9031			
73	Flexible Hoses LH Engine Compartment	Replacement - refer AMM 1000H Inspection		02.06.2020	96	44	02.06.2028
				9708	1000	495	10708
				12623		0	
73	Flexible Hoses RH Engine Compartment	Replacement - refer AMM 1000H Insp		02.06.2020	96	44	02.06.2028
				9708	1000	495	10708
				12623		0	
73	Fuel Pump LH Engine Dirven	Overhaul	TCM 649 368-63A1	02.06.2020	144	92	02.06.2032
				9708	1800	1295	11508
			# B10KA134R	12623		0	
73	Fuel Manifold Valve LH	Overhaul	TCM 641 032-11A8	02.06.2020	144	92	02.06.2032
				9708	1800	1295	11508
			# CFOB6801	12623		0	
73	Fuel Manifold Valve RH	Overhaul	TCM 641 032-11A8	02.06.2020	144	92	02.06.2032
				9708	1800	1295	11508
			# 10FA071R	12623		0	
73	Fuel Pump RH Engine Driven	Overhaul	TCM 649 368-27A2	02.06.2020	144	92	02.06.2032
				9708	1800	1295	11508
			# B10DA045R	12623		0	
74	Eng RH - Magneto LH & RH	500 hr Inspection i.a.w. AD96-12-07, TCM SB 639, 643 & 645	TCM S6RSC-25	22.03.2024		8	
			BL-500556-1	10139	500	426	10639
			# D20EA114R / D20EA141	13431		0	
74	Engine LH - Magneto LH	Overhaul - S20 Series MFD 08/2019	TCM S6LSC-25	22.03.2024	144	137	22.03.2036
			10-500556-3	10139	1800	1726	11939
			# D19HA125R	13431		0	

Inspector: Flightlog: 10213

Date: 23.10.2024

Landings: 13569

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
74	Engine LH - Magneto LH & RH	500 hr Inspection i.a.w. AD96-12-07, TCM SB 639, 643 & 645	TCM S6LSC-25	22.03.2024		8	
			10-500556-3	10139	500	426	10639
			# D19HA125R / D19HA126	13431		0	
74	Engine LH - Magneto RH	Overhaul - S20 Series MFD 08/2019	TCM S6LSC-25	22.03.2024	144	137	22.03.2036
			10-500556-3	10139	1800	1726	11939
			# D19HA126R	13431		0	
74	Engine RH - Magneto LH	Overhaul - S20 Series MFD 05/2020	TCM S6RSC-25	22.03.2024	144	137	22.03.2036
			BL-500556-1	10139	1800	1726	11939
			# D20EA114R	13431		0	
74	Engine RH - Magneto RH	Overhaul - S20 Series MFD 05/2020	TCM S6RSC-25	22.03.2024	144	137	22.03.2036
			BL-500556-1	10139	1800	1726	11939
			# D20EA141R	13431		0	
78	Turbocharger LH	1000 hr Inspection - refer AMM 1000H Insp	3AT6EE10J2	02.06.2020		0	
			646 396 D	9708	1000	495	10708
			# H-TRO1200007	12623		0	
78	Turbocharger RH	1000 hr Inspection - refer AMM 1000H Insp	3AT6EE10J2	02.06.2020		0	
			646 396 D	9708	1000	495	10708
			# H-TR0320003	12623		0	
78	Turbocharger LH	Overhaul	Rajay 3AT6EE10J2	02.06.2020	144	92	02.06.2032
			646 396 D	9708	1800	1295	11508
			# H-TRO1200007	12623		0	
78	Turbocharger RH	Overhaul	Rajay 3AT6EE10J2	02.06.2020	144	92	02.06.2032
			646 396 D	9708	1800	1295	11508
			# H-TR0320003	12623		0	
79	Oil Cooler LH	w. ENG TBO	NDM	02.06.2020	144	92	02.06.2032
			646 880	9708	1800	1295	11508
			# B06-4778-111	12623		0	

Airlink A/C TBO ITEM List **OE-FSM** PA34-200T, S/N 34-7970359, M/Y 1979

Page: 9/9

Inspector: Flightlog: 10213

Date: 23.10.2024

Landings: 13569

ATA-Nr.	Component	Remark	P/N	Instal. Date	T-Interv.	T-ToGo	T-NextDue
			Alt. P/N	A/C-Hrs	H-Interv.	H-ToGo	H-NextDue
			S/N	Ldgs	L-Interv.	L-ToGo	L-NextDue
79	Oil Cooler RH	w. ENG TBO	NDM	02.06.2020	144	92	02.06.2032
			646 880	9708	1800	1295	11508
			# 106-4776-342	12623		0	
80	Starter LH	Overhaul	MCL-6501-R	02.06.2020	144	92	02.06.2032
				9708	1800	1295	11508
			# H-S123361	12623		0	
80	Starter RH	Overhaul	MCL-6501-R	02.06.2020	144	92	02.06.2032
				9708	1800	1295	11508
			# H-S123365	12623		0	